

| Description                | PRTemp1000D   |                             |   |
|----------------------------|---|-----------------------------|---|
| Temperature Sensor         | Semiconductor   |                             |   |
| Temperature Range          | -20 °C to +80 °C (-4 °F to +176 °F)                           |                             |   |
| Temperature Resolution     | 0.1 °C (0.18 °F)  |                             |   |
| Calibrated Accuracy        | +0.5 °C (over 0 °C to 50 °C)                                  |                             |   |
| Pressure Sensor            | Semiconductor strain gauge                                    |                             |   |
| Pressure Range             | 0 to 30, 100, 300 and 500 PSID                                |                             |   |
| Maximum Line Pressure      | 1000 PSI  |                             |   |
| Pressure Resolution        | 0.002, 0.005, 0.02, 0.05 PSID                                 |                             |   |
| Pressure Accuracy          | ±0.25 %FSR, 0.1 % @ 25 °C typical                             |                             |   |
| Memory                     | 16,383/channel  |                             |   |
| Reading Rate               | 1 reading every 2 seconds up to 1 reading every 12 hours      |                             |   |
| Units                      | PSIA(G), inches, feet, bar, Torr, mmHg, Pascals               |                             |   |
| Required Interface Package | IFC110 or IFC200  |                             |   |
| Baud Rate                  | 2,400   |                             |   |
| Typical Battery Life       | 1 year  |                             |   |
| Operating Environment      | -20 °C to +80 °C (-4 °F to +176 °F), 0 %RH to 100%RH          |                             |   |
| Material                   | 303 stainless steel   |                             |   |
| Dimensions                 | Logger Body:<br>1.0 in OD x 6.7 in L<br>(25 mm OD x 170 mm L) | Cable:<br>12 in<br>(305 mm) | Transducers:<br>3.4 in x 3.0 in x 1.0 in<br>(86 mm x 76 mm x 25 mm) |
| Weight                     | 15.5 oz (440 g)   |                             |   |

PRTemp1000D



**PRTemp1000D**  
Differential Pressure and Temperature Data Logger

### Battery Warning

**WARNING: FIRE, EXPLOSION, AND SEVERE BURN HAZARD. DO NOT SHORT CIRCUIT, CHARGE, FORCE OVER DISCHARGE, DISASSEMBLE, CRUSH, PENETRATE OR INCINERATE. BATTERY MAY LEAK OR EXPLODE IF HEATED ABOVE 80 °C (176 °F).**

*Specifications subject to change.*

See MadgeTech's terms and conditions at [www.madgetech.com](http://www.madgetech.com)

MadgeTech, Inc.  
6 Warner Road • Warner, NH 03278  
Phone 603.456.2011 • Fax 603.456.2012  
[www.madgetech.com](http://www.madgetech.com) • [info@madgetech.com](mailto:info@madgetech.com)

DOC-1152035-00 REV 10 2014.07.07

## Product Notes

### Getting Started


To access the COM Port for the interface cable, unscrew the key-ring end cap. Screw the end cap onto the data logger until the o-ring cannot be seen, before deploying the device.

### Submergibility

The PRTemp1000D is weather resistant and rated IP63.

### Installation Instructions

Due to the potential for line pressure to exceed proof pressure, high line pressure must be applied simultaneously to each side of the sensor. To the right is a diagram of a recommended installation. Pressure snubbers are recommended to prevent damage from water hammers or other high intensity pressure events.

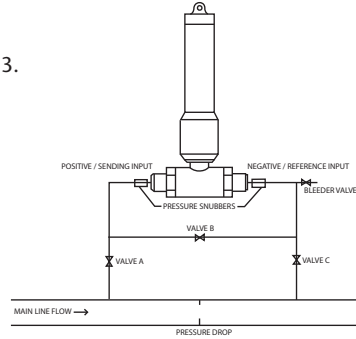

| Applying Line Pressure  | Removing Line Pressure  |
|---|---|
| <ul style="list-style-type: none"> <li>- Install sensor with valves "A" and "C" closed</li> <li>- Open bypass valve "B"</li> <li>- Crack bleeder valve</li> <li>- Slowly open valve "A" to apply pressure</li> <li>- Close bleeder valve</li> <li>- Open valve "C"</li> <li>- Close bypass valve "B"</li> </ul> | <ul style="list-style-type: none"> <li>- Open bypass valve "B"</li> <li>- Close valve "C"</li> <li>- Close valve "A"</li> <li>- Crack bleeder valve</li> <li>- Allow pressure to equalize with ambient</li> <li>- Uninstall sensor</li> </ul> |

### O-Rings

O-ring maintenance is a key factor when properly caring for the PRTemp1000D. The o-rings ensure a tight seal and prevent liquid from entering the inside of the device. Please refer to the application note "O-Rings 101: Protecting Your Data", found on the MadgeTech website, for information on how to prevent O-ring failure.

## Installation Guide

### Installing the Interface cable

- IFC200: Insert the device into a USB port. The drivers will install automatically.
- IFC110: Plug the serial cable into the port and verify it is secure.

### Installing the software

The Software can be downloaded from the MadgeTech website at the following link: [www.madgetech.com/software-download](http://www.madgetech.com/software-download). Follow the instructions provided in the Installation Wizard.

## Device Operation

### Connecting and Starting the data logger

- Once the software is installed and running, plug the interface cable into the data logger.
- Connect the USB end of the interface cable into an open USB port on the computer.
- The device will appear in the Connected Devices list, highlight the desired data logger.

- For most applications, select "Custom Start" from the menu bar and choose the desired start method, reading rate and other parameters appropriate for the data logging application and click "Start". ("Quick Start" applies the most recent custom start options, "Batch Start" is used for managing multiple loggers at once, "Real Time Start" stores the dataset as it records while connected to the logger.)
- The status of the device will change to "Running", "Waiting to Start" or "Waiting to Manual Start", depending upon your start method.
- Disconnect the data logger from the interface cable and place it in the environment to measure.

**Note:** The device will stop recording data when the end of memory is reached or the device is stopped. At this point the device cannot be restarted until it has been re-armed by the computer.

### Downloading data from a data logger

- Highlight the data logger in the Connected Devices list. Click "Stop" on the menu bar.
- Once the data logger is stopped, with the logger highlighted, click "Download". You will be prompted to name your report.
- Downloading will offload and save all the recorded data to the PC.

## Device Maintenance

### Battery Replacement

**Materials:** Small Needle Nose Pliers and Replacement Battery (TLH-5902)

- Carefully unscrew the sensor end cap and pull the electronics out.
- The battery is the purple cylinder on the circuit board.
- Gently pull out the old battery.
- Insert the new battery one lead at a time, using pliers to fully push the leads into the sockets. The battery should be flat against the circuit board, and the positive lead should be closest to the communications jack.
- Ensure the circuit board is inserted into the white plastic bushing. The sensor cable should not be twisted, or kinked. From the connection to the circuit board, it should run up towards the battery, then down to the sensor.
- Insert the electronics back into the tube and carefully screw the cap on.

### Recalibration

The PRTemp1000D standard calibration is performed at one temperature point at 25 °C, the pressure calibration is dependant upon the range.

| Range (PSID)            | 0-30        | 0-100        | 0-300         | 0-500         |
|-------------------------|-------------|--------------|---------------|---------------|
| Calibration Point (PSI) | 0 and 27-30 | 0 and 90-100 | 0 and 270-300 | 0 and 450-500 |

### Additional Services:

Custom calibration and verification point options available, please call for pricing.

*Call for custom calibration options to accommodate specific application needs.*

*Prices and specifications subject to change. See MadgeTech's terms and conditions at [www.madgetech.com](http://www.madgetech.com)*

*To send devices to MadgeTech for calibration, service or repair, please use the MadgeTech RMA Process by visiting [www.madgetech.com](http://www.madgetech.com), then under the services tab, select RMA Process.*